


PNEUMATIC HAND TOOLS

Q = 400 cfm minimum, tool 10" max distance from hood
Minimum duct velocity = 4000 fpm

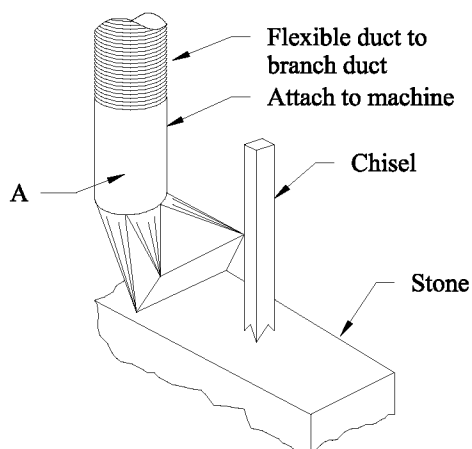

Abrasive blasting to be done in a room or cabinet; 500 fpm at all openings. See "Abrasive Blasting", VS-80-01

SURFACE MACHINE HOODS

Hood	cfm	Branch diam.
Baby surfacer	400	4"
Medium surfacer	600	5"

$h_e = 1.0 VP_d$ (at point A)



TITLE

GRANITE CUTTING AND FINISHING

FIGURE

VS-65-02

DATE

2-91